

# **TECHNICAL DATASHEET**

**REFERENCE: E2217+E2317** 

Old référence :

made of carbon fiber / para-aramid aluminized 340g / m<sup>2</sup> - seams in Kevlar® yarn - unlined version.

## **Description:**

Aluminized Jacket and Trousers

JACKET: Velcro closure and / or snaps.

TROUSERS: fly closure with snap fasteners - belt loops - jacket and trousers must be worn ENTIRELY to provide complete body / arm protection.



Recommandation

## <u>Dimensions:</u>

Sizes availaible S M L XL XXL XXL

protection against thermal hazards (flame, radiant heat and molten metal spraying) -attention it takes a while to remove the pants, in case of significant projections, preferably use a faster coat to remove

### The materials of this article do not contain any substance that can harm the health of the user

This PPE is in conformity with the requirements of the Directive 89/686/CEE. PPE class III, AET N°033/2017/0380CENTEXBEL

The CE marking on these items means the respect for the essentials requirements of European Directive on PPE based on the standard ISO 13688



A1 B1 C3 D3 E3 F0

A Limited flame spread
B Convective Heat (1 à 3)
C Radiant Heat (1 à 4)
D Projection of molten aluminium (1 à 3)
E Projection of molten iron (1 à 3)
F Contact Heat (1 à 3)

ISO 11612:2015

## Use only within the risks covered above






A dirty clothe may cause a reduced protection/ no washing recommended, clean with a wet sponge or brush, after use, stoker the garment turned over for drying on the inside

Storage: Protected from the light and in a dry place, free of moisture, oils, greases...

Recommandation: to ensure optimal protection the jacket and the trousers must be worn together and supplemented by appropriate PPE (gaiters, gloves, balaclava, IR screen ...) and worn on fire retardant clothing

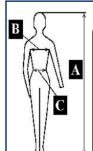

#### Coat/Apron

•			
Lenght	Α	Sizes	B et C
120 cm	164-170 cm	S – T2	92-96 cm
130 cm	170-182 cm	M – T3	96-104 cm
140 cm	182-188 cm	L – T4	104-112 cm
150 cm	188-194 cm	XL – T5	112-120 cm
160 cm	194-200 cm	XXL – T6	120-128 cm

For coveralls, take the greatest size between **B** or **C**. The measures must be taken on the person wearing his work clothes, because this equipment is worn over. In doubt between two sizes choose the larger one.